


CONTROL TRANSFORMER FOR CLOSING


- REMOTE CLOSE, MOMENTARY CONTACT, 1/2 SEC. MAX.

NOTE:

CONTACT POSITIONS ON PHASE FAILURE RELAYS ARE SHOWN WHEN SYSTEMS ARE ENERGIZED & NORMAL

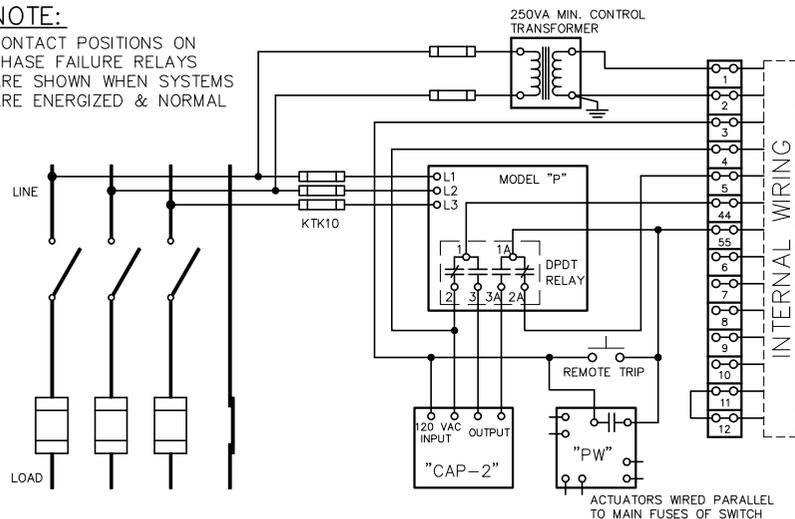


- CONTROL TRANSFORMER FOR CLOSING
- BOLT SWITCH MODEL "P" PHASE FAILURE RELAY
- BOLT SWITCH "CAP-2" CAPACITOR UNIT
- BOLT SWITCH "PW" PADDLE WHEEL BLOWN FUSE DETECTOR
- REMOTE TRIP

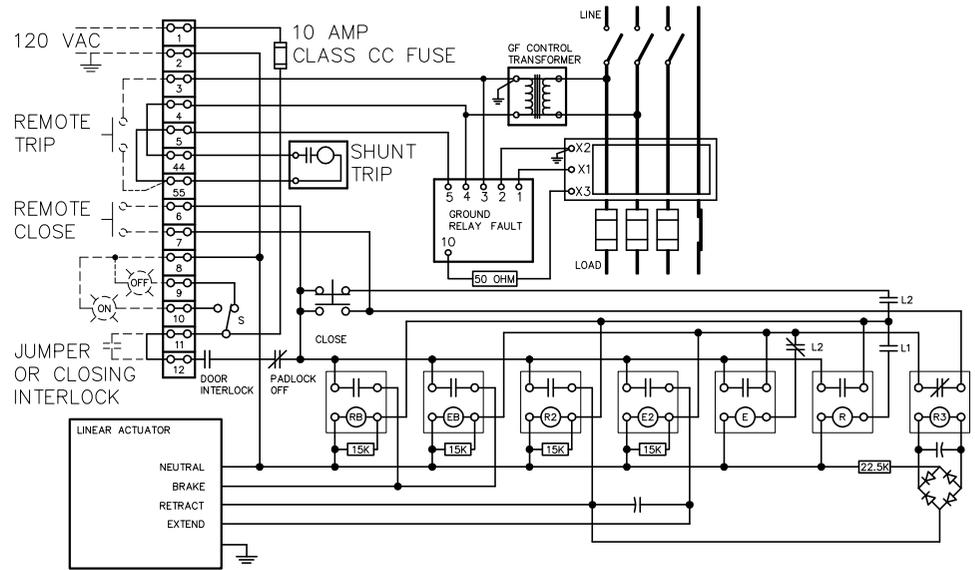

MST WIRING WITH INTEGRAL GROUND FAULT

- DOTTED LINES INDICATE FIELD WIRING OPTIONS

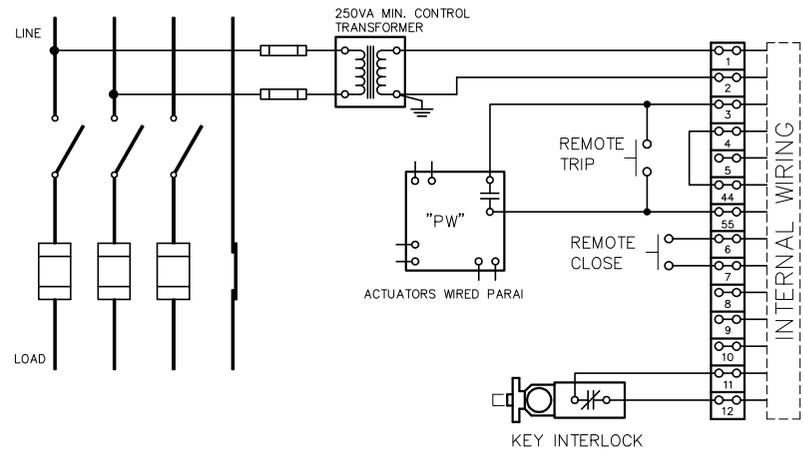

- CONTROL TRANSFORMER FOR CLOSING
- BOLT SWITCH "PW" PADDLE WHEEL BLOWN FUSE DETECTOR
- REMOTE CLOSE, MOMENTARY CONTACT, 1/2 SEC. MAX.
- REMOTE TRIP
- KEY INTERLOCK

WIRING DIAGRAMS FOR ADDING ACCESSORIES TO SWITCHES WITH MST & INT. GROUND FAULT

SCALE:	APPROVED BY:	DRAWN BY: WCE
DATE: 12-12-97		REVISED: 2

boltswitch, inc.
CRYSTAL LAKE, ILLINOIS 60014

DRAWING NUMBER
0-1522A